

SERVICE BULLETIN

www.keatingofchicago.com

KEATING
OF CHICAGO, INC. ®

1-800-KEATING

IFM FRYER (FLOOR MODELS ONLY)

If a popping noise is heard from the fryer during the cooking cycle, the following checks must be made in this order:

1. Fryer manifold gas pressure

Natural gas – 3.0 inches w/c

Propane gas – 10.5 inches w/c


2. Incoming gas pressure

Natural gas – 7.0 inches w/c

Propane gas – 11.0 inches w/c

3. Adjust the pilot adjustment screw in the gas valve.

The adjustment screw is located on top of the gas valve next to the black electrical housing.

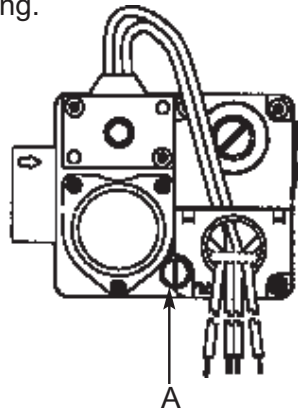

The pilot adjustment screw is located underneath the round head screw "A". Adjust with a small screw driver turn the adjustment screw clockwise until it is all the way down. Then turn the adjustment screw two full turns counterclockwise.